


B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments


Photograph 79

View of the water stains to the drywall along the perimeter wall in suite 616.



Photograph 80

View of the water-stained perimeter wall in office 614.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 81

View of the water-damaged perimeter wall paneling and over the desk in office 614.



Photograph 82

View of the water-damaged perimeter wall paneling and ceiling in office 611.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 83

View of the water-damaged perimeter wall paneling and ceiling finish in office 619.



Photograph 84

View of the water-damaged perimeter wall paneling, ceiling, and light fixture in office 606.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 85

View of the water damaged finishes in the northwest perimeter corner of the bank.



Photograph 86


View of the water-stained ceiling tiles and wall vinyl coverings below a penetration through the roof at the bank offices hall area.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 87

View of the water-stained and partially missing ceiling tiles over a bank office area.



Photograph 88

View of the formed concrete beam support above the partially missing ceiling tile.



**B-HCE Report Number 44-22003 – Pendant Properties, LLC
Attachments**


Photograph 89

View of a roof deck penetration above the partially missing ceiling tile in the bank office.



Photograph 90


View of a water damaged ceiling tile and water-stained crown trim and wall vinyl in the bank office filing area.



B-HCE Report Number 44-22003 – Pendant Properties, LLC Attachments

Photograph 91

View of the water-stained base trim and floor coverings in the bank office area.



Photograph 92

View of the water-stained ceiling tiles in the restaurant area.

